

Technical Bulletin

Model
911C2/C4
911 turbo

Group
7

Subject: Dashboard Cover Deformed

Part Identifier
7019

Number
9101

ATTENTION: Service Manager/Service Technician

Models Affected: *911 Carrera 2/4, model years '89 (K), '90 (L), '91 (M)
911 turbo, model year '91 (M)*

Concern: Wavy appearance of dashboard cover in the area of the defroster vent.

Repair Information: Dashboard covers which have a wavy appearance in the area of the defroster vent can be repaired. In addition, after replacement of a damaged dashboard cover, the defroster vent should protrude over the edge of the dashboard cover.

Where repairs are necessary, remove defroster vent. Use slide hammer with a suitable tip (Figure 1) to move defroster vent brackets straight rearward (Figure 2).

Careful: Only light tapping of slide hammer is required to move the brackets.

Additionally, washers can be installed between the defroster vent mounting points and the brackets to obtain a good fit for the defroster vent.

Install defroster vent and check alignment.

P
O
R
S
C
H
E
C
A
R
S
N
O
R
T
H
A
M
E
R
I
C
A
I
N
C
.



Figure 1

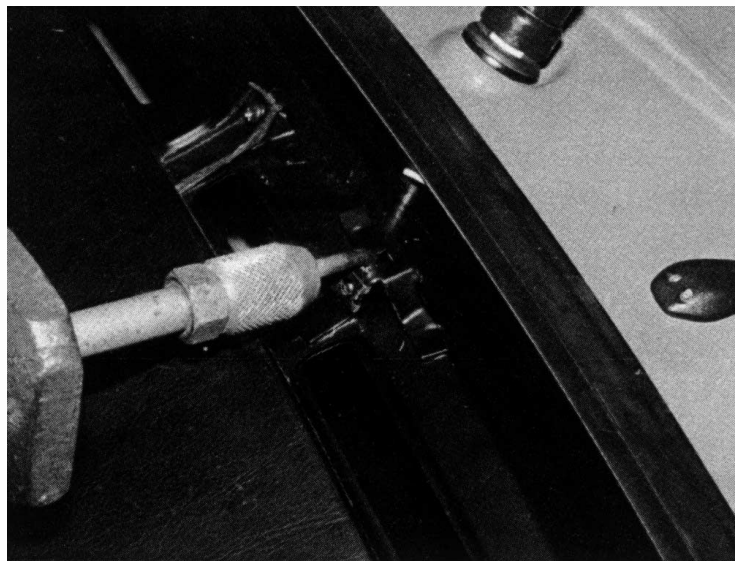


Figure 2

Warranty Claim Information:

Damage Code: 7019 30 000 1

Labor Operation: 7019 190 A 50 Time Units

©1991 Porsche Cars
North America, Inc.
All rights reserved. Cannot be
reproduced without written permission.
Porsche Technical Publications



SERVICE

Page 1 of 1
October 11, 1991