

Technical Bulletin

Model
911C2/C4

Group
6

Subject: Seat Belt Bolt Cover, Deformed

Part Identifier
6876

Number
9004

ATTENTION: Service Manager/Service Technician

Models Affected: **911 Carrera 2 and 911 Carrera 4
Model Year 1989 (K) and 1990 (L)**

Concern: Hot air from the engine heats up the right rear seat belt anchor bolt and deforms the plastic bolt cover.

Vehicle Information: A modified anchor bolt cover is installed from production date:
August 28, 1989

VIN: 96_LS450081 Coupe
96_LS460062 Targa


Repair Information: The modified bolt cover can be installed in vehicles prior to the above VIN as follows:

Remove bolt cover and bolt (A in Figure). Install new bolt, bushing and cover (B in Figure). Torque bolt to 50 Nm (37 ft. lbs.).

Both sides, left and right should be modified.

Parts Information:
New Cover: 964 803 141 00
New Bushing: 999 924 064 02
New Bolt: 803 019 811 B

Labor Operation: 20 TU (both sides)
6876190A

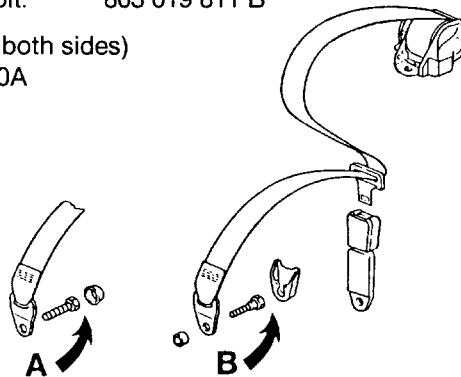

Dealership _____ Service manager _____ Shop foreman _____ Service technician _____
Distribution _____
Routing _____ Asst. manager _____ Warranty admin. _____ Service technician _____

©1990 Porsche Cars
North America, Inc.
All Rights Reserved
Technical Support
Department



SERVICE

Page 1 of 1
May 29, 1990

PORSCHE CARS NORTH AMERICA - 20