

Technical Bulletin

Model
911 C2/C4

Group
9

Subject: **Glove Box Lamp Switch
(Unintentional Alarm Activation)**

Part Identifier
9607

Number
9304

ATTENTION: Service Manager/Service Technician

Models Affected: **911 C2/C4 1990-1992**
911 Turbo 1991-1992

Concern: Unfavorable assembly tolerances in the glove compartment door / lamp switch may cause unintentional activation of the vehicle alarm or excessive current draw which could lead to a discharged battery.

Repair Information: In vehicles produced after October 1991, a rubber washer, Part Number 999 025 209 40 was installed between the hex portion of the glove compartment lamp switch and the opening in the knee bar. The installation of the rubber washer helps to maintain a more favorable tolerance between the glove box door and glove compartment lamp switch.

The rubber washer may be installed in vehicles produced prior to October 1991. It is necessary to remove the glove box to install the washer. Installation of the glove box switch is correct when the glove box lamp turns off before the glove box fully latches in the closed position.

General Information: As of model year 1992, a new switch, Part Number 964 613 602 00, was installed. This switch can only be used in model year 1992-on vehicles.

Parts Information: 964 613 602 00 Glove box switch 92-on
901 615 601 02 Glove box switch 90 & 91
999 025 209 40 Rubber washer

Warranty Information: (If applicable) Damage Code: 960710 0002
Labor Operation: 9607 1900 R&R Contact Switch 20TU
for Glove Box

Glove Box Switch

