

Technical Bulletin

Model
911 C2/C4

Group
8

Subject: Temperature Sensor for
Engine Compartment Blower


Part Identifier
8019

Number
9204

ATTENTION: Service Manager/Service Technician

Models Affected: *911 Carrera 2 and 4
From Model Year 1989-1992*

Concern: After the ignition key is removed, the engine compartment blower motor may run on too long or does not switch off which can cause a discharged battery. Corrosion in the temperature sensor for the engine compartment blower may be responsible.

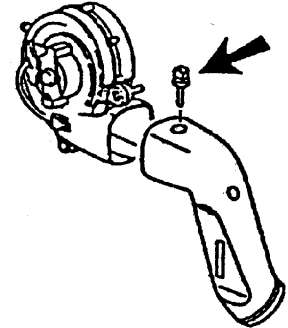

General Information: As of January 1992, the sealing of the sensor contacts and the sensor housing was improved. The sensor with improved sealing is marked as follows:

- Temperature sensor tip has white sealer.
- Electrical connectors are sealed with transparent sealer.
- A green paint dot on sensor housing (temporary).
- Production date stamped in black ink in the area of "Hella" marking.
From production date 421 (42 = week, 1 = 91 year)
indicates new version sensor.

Repair Information: Only the new version temperature sensor is available for repairs. When connecting the cable harness to the sensor, be certain the harness connector sealing gasket is in place.

Parts Information: Temperature sensor Part Number 964 659 120 00
Part number remains unchanged.

P
O
R
S
C
H
E

C
A
R
S

N
O
R
T
H

A
M
E
R
I
C
A

I
N
C
.

