

Technical Bulletin

Model
All

Group
4


Subject: Power Steering Pump Replacement

Part Identifier
4898

Number
9006

ATTENTION: Service Manager/Service Technician

Concern: Proper cleaning of system when replacing power steering pumps.

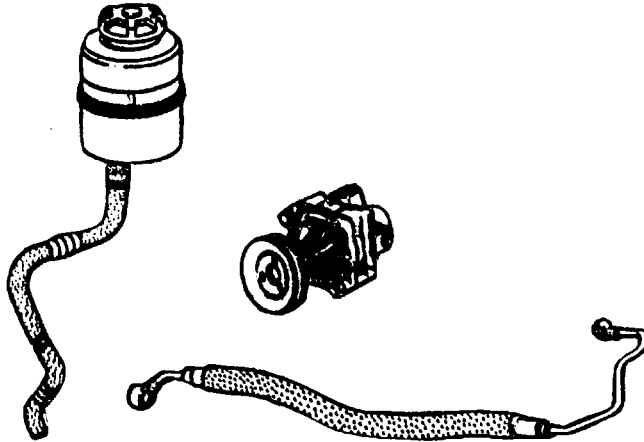

Repair Procedure:

Whenever a power steering pump is replaced, the hose from the reservoir to the pump, the hose from the pump to the rack, and the hose from the rack to the reservoir* , all have to be flushed out with clean solvent to ensure that no foreign material is in the system. The oil reservoir must be replaced because it is not serviceable.

*The return line from the rack to the reservoir includes the oil cooler and is more easily cleaned in place on the car.

Additional time — 40 TU

Dealership
Distribution
Routing

Service manager _____
Asst. manager _____

Shop foreman _____
Warranty admin. _____

Service technician _____
Service technician _____

©1990 Porsche Cars North America, Inc.
All rights reserved. Cannot be reproduced without written permission.
Porsche Technical Publications



SERVICE

Page 1 of 1
August 14, 1990