

Technical Bulletin

Model
911C2/C4

Group
6

Subject: Rear Spoiler Gear Mounting Screws

Part Identifier
6672

Number
9104

ATTENTION: Service Manager/Service Technician

Models Affected: *911 Carrera 2 and 911 Carrera 4
Model Year 89 (K), 90 (L) and 91 (M)*

Concern: Undesired loosening of rear spoiler drive gear mounting screws (Figure 1).

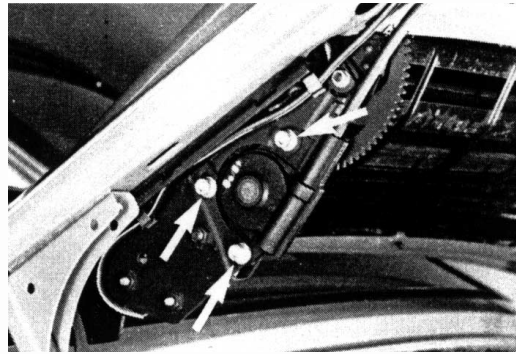


Figure 1

Vehicle Information: Microencapsulated rear spoiler drive gear mounting screws are installed from production date: December 12, 1990.

VIN: 96 _ MS 41 1050 - Coupe
96 _ MS 44 0499 - Targa
96 _ MS 46 1184 - Cabriolet

Service Information: When repairing loose spoiler drive gears on vehicles prior to the above VIN, microencapsulated mounting screws should be installed (arrow in Figure 2 on the following page).

PORSCHE CARS NORTH AMERICA - INC.



Technical Bulletin

Model
911C2/C4

Group
6

Subject: Rear Spoiler Gear Mounting Screws

Part Identifier
6672

Number
9104

Service Information (continued):

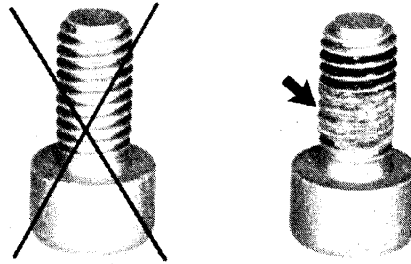


Figure 2

Parts Information:

Microencapsulated screw M6 x 12 Part Number N 014 701 7
(three required per car).

PORSCHE CARS NORTH AMERICA, INC.

